STEP 2 Remove an available slot cover from the chassis of the computer.

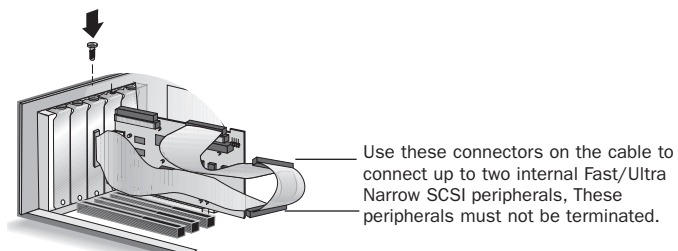Remove Slot Cover (Preferably Next to the SCSI Card 2940U2W)
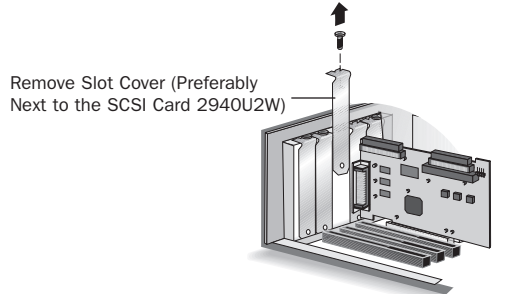
STEP 3 Plug one end of the cable to the 50-pin internal Ultra SCSI connector on the SCSI Card 2940U2W.

50-pin Internal Ultra SCSI Connector

Standard 50-pin Internal-to-High-density 50-pin External Ultra SCSI Cable
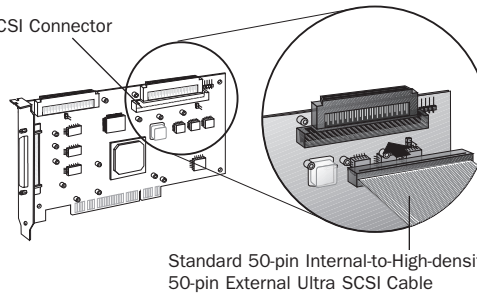
STEP 4 Secure the mounting bracket of the cable to the exposed card slot opening in the chassis of the computer.

Use these connectors on the cable to connect up to two internal Fast/Ultra Narrow SCSI peripherals, These peripherals must not be terminated.

9

STEP 5 — Connect one end of the external SCSI cable to the 50-pin external connector on the internal-to-external cable.

68-pin External Ultra2 SCSI Connector

High-density 50-pin External SCSI Cable (Not Included in Kit)

High-density 50-pin External Connector
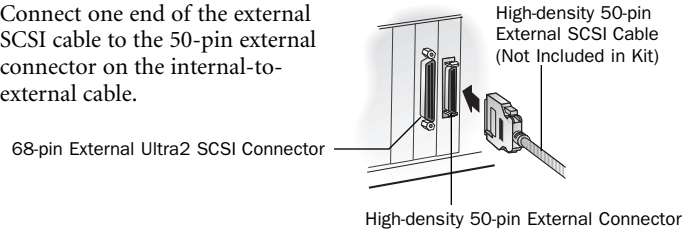
STEP 6 — Connect the other end of the external SCSI cable to a SCSI connector on the back of the external SCSI peripheral. If you are installing only one external peripheral, terminate the peripheral and skip to Step 8.

SCSI Terminator (Not Included in Kit)
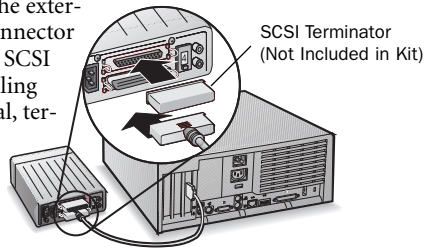
STEP 7 — Connect other external peripherals by connecting each peripheral to the previous one until all peripherals are connected. The peripheral at the end of the chain must be the only external peripheral terminated.

Terminated SCSI Peripheral
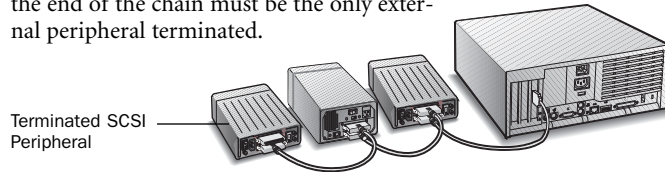
STEP 8 — Connect all power cables to the external peripherals.

10